

Bohle Glass Equipment South Africa Unit 3 Graphite Industrial Park Fabriek Street Strydom Park 2125

13th November 2019

AGL

Dear Gavin, David and Sebastian

DESIGN CONSULTATION REPORT (NMK#01 1119)

IMPACT TESTING OF 12mm CLEAR TOUGHENED SAFETY GLASS INTO VETROMOUNT SURFACE MOUNTED CHANNEL SYSTEM

The test took place at Bohle's factory, situated at Unit 2 Graphite Industrial Park, Fabriek Street, Strydom Park on the 12th November 2019. Present at the test was Gavin Francey, David Flury and Sebastian Till from Bohle Glass Equipment, and Belinda Louw MSAGI – Candidate, Jason Fijac MSAGI - Candidate and myself from National Glass Distribution.

The glass panel tested was 12mm Clear Toughened Safety Glass, 1250(w) x 1100(h), supplied by National Glass Distribution, glazed into the Bohle VetroMount surface mounted aluminium channel system. The glass was secured to the channel every 250mm with Bohle's plastic mounting elements supplied and a rubber gasket to seal the system. The channel was secured to the slab using 10mm x 100mm Hilti HUS3 anchors at 400mm centres. No handrail was present on the test specimen.




Design Consultation Report: NMK# 01 1119

Page 1 of 4


Tel: +27(0)10 593 8440 | Cell: +27(0)83 225 9924 | Email: nkruger@natglass.co.za | www.natglass.co.za Natglass Distributors (PTY) Ltd t/a National Glass Distribution | Head Office: 164 Russell Road, Central, Port Elizabeth, 6001



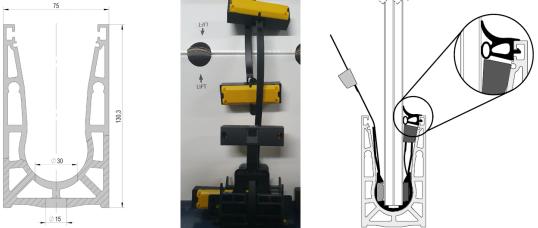

SWING BAG TEST

The swing bag impactor consisted of a bag containing 30Kg of dry sand. The centre of the bag was aligned with the centre of the glass panel and with the impact zone being 800mm from finished floor level. To replicate 400J impact, the drop height was calculated at a height of 1360mm resulting in an overall drop height of 2160 mm from finished floor level. The bag was released, and the impactor struck the glass with no breakage. The system deflected 5mm after the first impact. The test was repeated a second time again with no glass breakage. The system deflected a further 5mm, which resulted in overall deflection of 10mm after two impacts. Please note that no remedial work was done to the system between impacts. A further test was conducted 250mm in from the left edge of the glass again with no breakage.

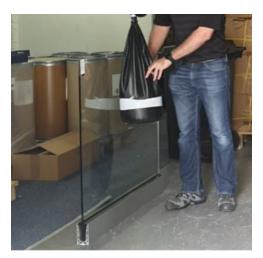



Design Consultation Report: NMK# 01 1119



Tel: +27(0)10 593 8440 | Cell: +27(0)83 225 9924 | Email: nkruger@natglass.co.za | www.natglass.co.za Natglass Distributors (PTY) Ltd t/a National Glass Distribution | Head Office: 164 Russell Road, Central, Port Elizabeth, 6001



LINE LOAD

| BALUSTRADES - LINE LOADS | | | | | | | NATIONAL GLAS | | |
|---|-------------------|-------------|--------------|-----------------------|-----------------------------|----------------|---|---------|----------|
| | | | | | | | Load | 0.5 | Kn |
| | | | Customer | | | Glass Systems | Width | 1.250 | met |
| .oa d = KN | 0.500 | | Project | | 12mm TSG VetroMount Channel | | Height to Support | 1.100 | Met |
| Width = m | 1.250 | | Date | | 12-Nov-19 | | Safety Factor | 50% | % |
| /ertical Height to support = m | 1.100 | Ins per | | Inspected by Nic, Bel | | inda and Jason | Design Stress | 50 | Mpa |
| | | | Res | sult | | Pass | Glass Thickness | 11.7 | mm |
| Moment Line Load = kN/m | 0.6875 |] | | | | | Moment Line Load = kN/m | 0.687 | 5 |
| Modulus of Rapture = Safety Fact | or x Design Stres | s x Panel W | idth x (Glas | s Thickness | sqrd)/6 | 50% | Safety Factor = % | 509 | 2 |
| | 50000000 | 55000000 | | 50000000 | 55000000 | 6000000 | | 5000000 | - |
| Design strength = pa Panel Width = m | 1.25 | 1.25 | 1.25 | 1.25 | 1.25 | | Design strength = pa Panel Width = m | | _ |
| | 1.25 | 1.25 | 11.7 | 1.25 | 145 | 1.25 | Glass thickness = mm | 1.25 | _ |
| Glass thickness = mm | 11.7 | 11.7 | 11./ | 14.5 | 14.5 | 14.5 | Glass trickness = mm | 11.7 | <u>/</u> |
| Modulus Rapture = kN/m | 0.71296875 | 0.784266 | 0.855563 | 1.095052 | <u>1.204557292</u> | 1.3140625 | Modulus Rapture = kN/m | 0.71296 |) |
| ine Load vs Modulus Rapture | YES | YES | YES | YES | YES | YES | Line Load vs Modulus Rapture | YES | |
| Blass Thickness | 0.011489125 | 0.010954 | 0.010488 | 0.011489 | 0.010954451 | 0.010488088 | Min Glass Thickness | 0.01148 | 9 |
| nm | 11.48912529 | 10.95445 | 10.48809 | 11.48913 | 10.95445115 | 10.48808848 | mm | 11.4891 | 3 |
| | | B | ALUST | RADES | 6 - On Site I | mpact Test | | | |
| mpact | 400 | Joules | | PanelW | /idth | 1.25 m | | _ | |
| Bag Weight | 30 | Kg | Panel Height | | | 1 m | PASSED | | |

CONCLUSION

0.8 m

0.8 m

Based on the impact tests conducted and calculations on the glass pane, the glazing element of the test specimen **conforms** with the **impact** requirement for a **domestic residential application** of SANS 10137 and SANS 10160 – 2.

1st Impact Point

2nd Impact Point

2.160 Metters

Please take note the following:

Drop Height required

Overall Bag Drop Height

1.360 Meters

2.160 Meters

1st Impact Point

- This design consultation report is not an installation certificate as there could be several variables with a site installation.
- This design consultation report is not transferable and is limited only to the glazing element of the panels tested; and all other components, fixing details and structural work will need to be covered by the relevant Competent Persons in their respective fields.
- For Commercial or Escape Route applications, further physical testing or engineering reports may be required as the line load on these applications would increase to 1,5kN and 3,0kN respectively.

Design Consultation Report: NMK# 01 1119

Page 3 of 4

EAGL

Tel: +27(0)10 593 8440 | Cell: +27(0)83 225 9924 | Email: nkruger@natglass.co.za | www.natglass.co.za Natglass Distributors (PTY) Ltd t/a National Glass Distribution | Head Office: 164 Russell Road, Central, Port Elizabeth, 6001



- When Toughened Safety Glass breaks from whatever reason, the glass shatters into 1000's of small particles and will not remain in its original position, hence we would recommend a handrail on all Toughened Safety Glass installations as an additional safety support and feature.
- Regular maintenance should be carried out to ensure that product remains fit for purpose, as gaskets and fixing details can loosen over a period of time resulting in possible product failure.
- All installed balustrades fall under the responsibility of the project Pr Engineer (Struc), and require their approval and final sign off as a complete system with regards to SANS 10400 A Form 4.

Should a glazing element installation certificate be required, please contact your installer to arrange a suitable date for the required tests to be conducted at site.

Kind Regards

Af Ira lan

Nic Kruger MSAGI CP(G) Competent Person (Glazing)

Slow

Belinda Louw MSAGI - Candidate Managing Director

Jason Fijac M Arch (Prof); MSAGI - Candidate National Glass - Architect

Design Consultation Report: NMK# 01 1119

EAGLI